


Product Tech Bulletin Advisory

Date: 7/7/2009

Affected Product: 679-SI-KIT Rev. C, Lucas L679 Installation

Issue Description: Back of LED Board coming into contact with taillight assembly bracket causing possible short-circuit condition to system ground, which could possibly cause damage to the LED Board. This could render the LED non-functional, which may cause unsafe condition.

Remedy: Apply vinyl electrical insulating tape to the mounting bracket's surface to cover all metal in the shaded area shown in the image below, to create an insulated safe-zone prior to installing the LED Board to the mounting bracket.

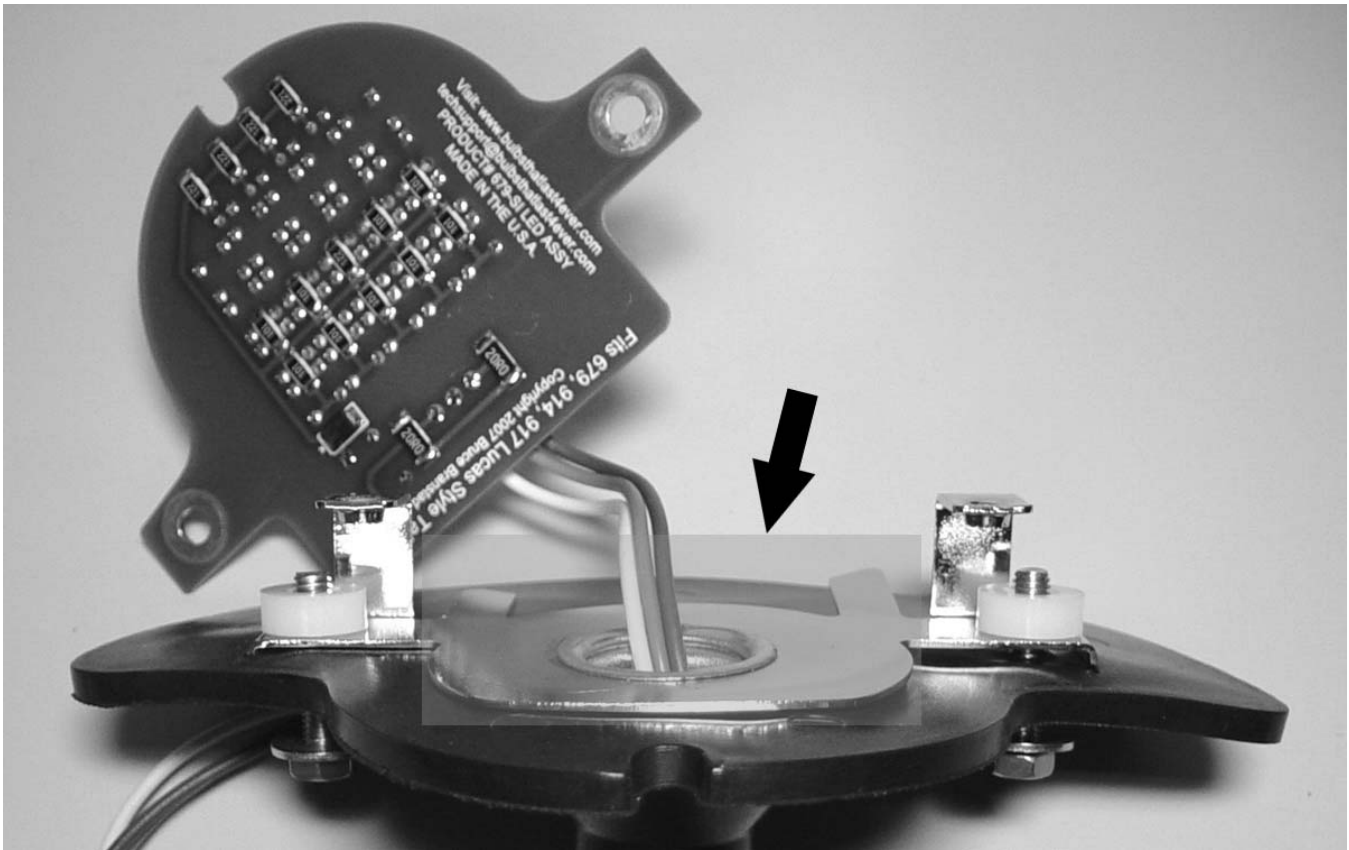

Disclaimer:

Under no circumstances will Bulbthatlast4ever or its representatives be responsible or liable for any incidental or consequential property damages or personal injuries arising from or in connection with the use or installation of any of the listed foregoing products or devices. Rev. 7/09